

Temp-Tec NL-517

DESCRIPTION AND GENERAL PROPERTIES

- **Material** Neoprene
- **Length (inches)** 17»
- **Thickness (inches)** Heavy Weight
- **Colour/Color** Black / Blue
- **Interior finish** Knitted thermal protection
- **Exterior finish** Pebbled
- **Size / EAN** 8 9 10
- **Packaging** 1 pair/bag - 6 pairs/carton



PERFORMANCE RESULTS

Certification category 3

CE 0334



111



02XXXX



ACJKL




2212

Legends



MECHANICAL HAZARDS EN 388

PERFORMANCE LEVELS

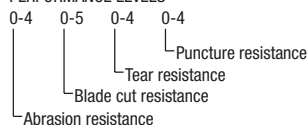

LOW CHEMICAL PROTECTION EN 374



MICRO-ORGANISMS EN 374




RADIOACTIVE CONTAMINATION EN 421



HEAT AND FIRE EN 407

PERFORMANCE LEVELS

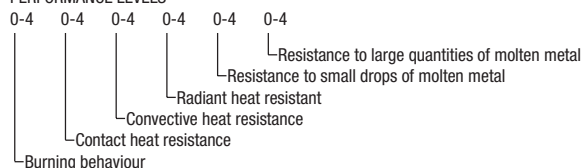


SPECIFIC CHEMICAL PROTECTION EN 374

Letter Code	Chemical product
A	Methanol
B	Acetone
C	Acetonitrile
D	Dichloromethane
E	Carbon Disulfide
F	Toluene
G	Diethylamine
H	Tetrahydrofurane
I	Ethyl acetate
J	n-Heptane
K	Sodium hydroxide 40%
L	Sulphuric acid 96%



COLD HAZARDS EN 511

PERFORMANCE LEVELS



For more details: www.mapa-pro.com

MAPA[®]
PROFESSIONAL
www.mapa-pro.com

DESCRIPTION AND GENERAL PROPERTIES

- Multi-purpose chemical resistance (acids, aliphatic solvents) increased by the thickness of the material
- Excellent thermal insulation, due to double-knit cotton
- Good grip of wet or slippery objects,

MAIN FIELDS OF USE

INSTRUCTIONS FOR USE

Instructions for use

- It is recommended to check that the gloves are suitable for the intended use, because the conditions of use at workplace may differ from the «CE»-type tests. For very high or low temperatures, be careful that a sustained contact does not cause burns.
- It is not recommended for persons sensitized to dithiocarbamates to use these gloves.
- Put the gloves on dry, clean hands.
- Do not use the gloves in contact with a chemical for a duration in excess of the measured breakthrough time. Refer to the website www.mapa-pro.com or contact the Technical Customer Service - MAPA PROFESSIONAL (stc.mapaspontex@mapaspontex.fr) in order to know this breakthrough time. Use 2 pairs alternatively when in long duration contact with a solvent.
- Turn the cuff end down in order to prevent a hazardous chemical from dripping onto the arm.
- Ensure the inside of the gloves is dry before putting them on again.

Storage conditions

Store the gloves in their original packaging at a temperature not below 5°C.

Laundering conditions

Before taking off the gloves, clean them as appropriate :

- in use with paints, pigments and inks : wipe with a clean cloth dampened with a suitable solvent, and rub over with a dry cloth
 - in use with a solvent (diluents, etc...) : rub over with a dry cloth
 - in use with acids or alkalies : thoroughly rinse the gloves under running water, and rub over with a dry cloth
- Caution : improper use of the gloves or submitting them to a cleaning or laundering process that is not specifically recommended can alter their performance levels.

Food contact US

FDA 21CFR 177.2600

LEGISLATION

This product is not classified as hazardous according to the directive 1999/45/EC of the European Parliament and of the Council.

This product does not contain any substances of very high concern according to the regulation n° 1907/2006 of the European Parliament and of the Council (REACH).

- CE-Type Examination Certificate

0072/014/162/06/98/0129

- Issued by the notified body nr

0072

I.F.T.H. – av. Guy de Collongue - F-69134 ECULLY CEDEX

- Quality assurance certificat

0334 Asqual 14 rue des Reculettes -F-75013 PARIS