Safety Data Sheet

* Trusted Quality Since 1921 *

www.rustoleum.com

1. Identification			
Product Name:	ROHPER LSPR 6PK GLOSS HIGH TMP ALUMINUM	Revision Date:	3/24/2015
Product Identifier:	V2116838	Supercedes Date:	New SDS
Product Use/Class:	Topcoat/Aerosol		
Supplier:	Rust-Oleum Corporation 11 Hawthorn Parkway Vernon Hills, IL 60061 USA	Manufacturer:	Rust-Oleum Corporation 11 Hawthorn Parkway Vernon Hills, IL 60061 USA
Preparer:	Regulatory Department		
Emergency Telephone:	24 Hour Hotline: 847-367-7700		

2. Hazard Identification

EMERGENCY OVERVIEW: Extremely flammable liquid and vapor. Vapors may cause flash fire or explosion. Harmful if inhaled. May affect the brain or nervous system causing dizziness, headache or nausea. Contents Under Pressure. May cause eye, skin, or respiratory tract irritation. KEEP OUT OF REACH OF CHILDREN. Harmful if inhaled. Harmful if swallowed. Causes eye irritation. Use ventilation necessary to keep exposures below recommended exposure limits, if any. Vapor Harmful. Causes Eye, Skin, Nose, and Throat Irritation.

Classification

Symbol(s) of Product



Signal Word Danger

Possible Hazards

81% of the mixture consists of ingredient(s) of unknown acute toxicity

GHS HAZARD STATEMENTS

Flammable Aerosol, category 1	H222	Extremely flammable aerosol.
Flammable Liquid, category 1	H224	Extremely flammable liquid and vapour.
Acute Toxicity, Oral, category 5	H303	May be harmful if swallowed.
Acute Toxicity, Dermal, category 5	H313	May be harmful in contact with skin.
Skin Irritation, category 2	H315	Causes skin irritation.
Eye Irritation, category 2	H319	Causes serious eye irritation.
Acute Toxicity, Inhalation, category 4	H332	Harmful if inhaled.
STOT, single exposure, category 3, RTI	H335	May cause respiratory irritation.
STOT, single exposure, category 3, NE	H336	May cause drowsiness or dizziness.
Aspiration Hazard, category 2	H305	May be harmful if swallowed and enters airways.
Eye Irritation, category 2B	H320	Causes eye irritation.
Flammable Aerosol, category 1	H280	Contains gas under pressure; may explode if heated

Germ Cell Mutagenicity, category 1B	H340	May cause genetic defects. Classified as mutagenic Category 1 if one ingredient is present at or above 0.1%. Applies to liquids, solids (w/w units) and gases (v/v). The substance may also have its own exposure limit. Routes of exposure are dependent on ingredient form.
Carcinogenicity, category 1A	H350	May cause cancer. Classified as carcinogenic Category 1 on the basis of epidemiological and/or animal data. Mixtures are classified as carcinogenic when at least 1 ingredient has been classified as carcinogenic and is present at 0.1% or above Routes of exposure are dependent on ingredient form.May cause cancer <state cause="" conclusively="" exposure="" hazard="" if="" is="" it="" no="" of="" other="" proven="" route="" routes="" that="" the="">.</state>
GHS PRECAUTIONARY STATEMENT		
P211		y on an open flame or other ignition source.
P220	-	away from clothing//combustible materials.
P235	Keep cool.	d aantainaw Da nat niawaa ay buwa ayan aftay yaa
P251 P375		d container: Do not pierce or burn, even after use.
P102	-	motely due to the risk of explosion. Freach of children.
P102	Read label	
P202		dle until all safety precautions have been read and understood.
P234		n original container.
P260	• •	the dust/fume/gas/mist/vapours/spray.
P261		hing dust/fume/gas/mist/vapours/spray.
P262		n eyes, on skin, or on clothing.
P264	-	roughly after handling.
P270		drink or smoke when using this product.
P271		itdoors or in a well-ventilated area.
P273	Avoid relea	se to the environment.
P280	Wear prote	ctive gloves/protective clothing/eye protection/face protection.
P281	Use person	al protective equipment as required.
P285	In case of in	nadequate ventilation wear respiratory protection.
P312		ON CENTER or doctor/physician if you feel unwell.
P351		ously with water for several minutes.
P374	-	th normal precautions from a reasonable distance.
P402	Store in a d	
P210		from heat/sparks/open flames/hot surfaces No smoking.
P410+P412 P240		n sunlight. Do not expose to temperatures exceeding 50°C / 122°F.
P240 P241		nd container and receiving equipment.
P241 P242		ion-proof electrical/ventilating/lighting// equipment. on-sparking tools.
P243	-	utionary measures against static discharge.
P303+P361+P353	-	I (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin
	with water/s	
P370+P378	In case of fi	re: Use for extinction.
P403+P235	Store in a w	vell-ventilated place. Keep cool.
P501	Dispose of	contents/container to
P321		atment (see on this label).
P352		plenty of soap and water.
P362		ntaminated clothing and wash before reuse.
P332+P313		tion occurs: Get medical advice/attention.
P305+P351+P338		: Rinse cautiously with water for several minutes. Remove contact lenses, if
D227 D212		l easy to do. Continue rinsing.
P337+P313 P304+P340		ion persists: Get medical advice/attention. D: Remove victim to fresh air and keep at rest in a position comfortable for
	breathing.	
P405	Store locke	•
P403+P233		vell-ventilated place. Keep container tightly closed.
P201	-	cial instructions before use.
P308+P313	-	or concerned: Get medical advice/attention.
P302+P350		I: Gently wash with plenty of soap and water.

HAZARDOUS SUBSTANCES

<u>Chemical Name</u>	<u>CAS-No.</u>	<u>Wt.%</u> Range	GHS Symbols	GHS Statements
Acetone	67-64-1	25-50	GHS02-GHS07	H225-336-319
Liquefied Petroleum Gas	68476-86-8	25-50	GHS08	H340-350
Xylene (mixed isomers)	1330-20-7	2.5-10	GHS02-GHS07	H226-312-332-315
Solvent Naphtha, Light Aromatic	64742-95-6	2.5-10	GHS08	H340-350
1,2,4-Trimethylbenzene	95-63-6	2.5-10	GHS02-GHS07	H226-335-332-315-319
Hydrous Magnesium Silicate	14807-96-6	2.5-10		
Ethylbenzene	100-41-4	1.0-2.5	GHS02-GHS07	H225-332
Aluminum Flake	7429-90-5	1.0-2.5	GHS02	H228-261
1,3,5-Trimethylbenzene	108-67-8	1.0-2.5	GHS02-GHS07	H226-335

The text for GHS Hazard Statements shown above (if any) is given in the "16. Other Information" section.

4. First-aid Measures

FIRST AID - EYE CONTACT: Immediately flush eyes with plenty of water for at least 15 minutes holding eyelids open. Get medical attention. Do NOT allow rubbing of eyes or keeping eyes closed.

FIRST AID - SKIN CONTACT: Wash skin with soap and water. Remove contaminated clothing. Get medical attention if irritation develops or persists.

FIRST AID - INHALATION: Remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get immediate medical attention. Do NOT use mouth-to-mouth resuscitation. If you experience difficulty in breathing, leave the area to obtain fresh air. If continued difficulty is experienced, get medical assistance immediately.

FIRST AID - INGESTION: Aspiration hazard: Do not induce vomiting or give anything by mouth because this material can enter the lungs and cause severe lung damage. Get immediate medical attention. If swallowed, get medical attention.

5. Fire-fighting Measures

EXTINGUISHING MEDIA: Alcohol Film Forming Foam, Carbon Dioxide, Dry Chemical, Water Fog

UNUSUAL FIRE AND EXPLOSION HAZARDS: FLASH POINT IS LESS THAN 20 °. F. - EXTREMELY FLAMMABLE LIQUID AND VAPOR!Water spray may be ineffective. Closed containers may explode when exposed to extreme heat due to buildup of steam. Closed containers may explode when exposed to extreme heat. Vapors may form explosive mixtures with air. Vapors can travel to a source of ignition and flash back. Isolate from heat, electrical equipment, sparks and open flame. Perforation of the pressurized container may cause bursting of the can. No unusual fire or explosion hazards noted. Keep containers tightly closed.

SPECIAL FIREFIGHTING PROCEDURES: Full protective equipment including self-contained breathing apparatus should be used. Evacuate area and fight fire from a safe distance. Water may be used to cool closed containers to prevent pressure buildup and possible autoignition or explosion. Use water spray to keep fire-exposed containers cool. Containers may explode when heated.

6. Accidental Release Measures

STEPS TO BE TAKEN IF MATERIAL IS RELEASED OR SPILLED: Contain spilled liquid with sand or earth. DO NOT use combustible materials such as sawdust. Isolate the hazard area and deny entry to unnecessary and unprotected personnel. Remove all sources of ignition, ventilate area and remove with inert absorbent and non-sparking tools. Dispose of according to local, state (provincial) and federal regulations. Do not incinerate closed containers. Ventilate area, isolate spilled material, and remove with inert absorbent. Dispose of contaminated absorbent, container, and unused contents in accordance with local, state, and federal regulations.

7. Handling and Storage

HANDLING: Wash thoroughly after handling. Wash hands before eating. Remove contaminated clothing and launder before reuse. Use only with adequate ventilation. Follow all MSDS/label precautions even after container is emptied because it may retain product residues. Avoid breathing fumes, vapors, or mist. Avoid contact with eyes, skin and clothing.

Date Printed: 3/24/2015

STORAGE: Keep containers tightly closed. Isolate from heat, electrical equipment, sparks and open flame. Contents under pressure. Do not store above 120 ° F. Store large quantities in buildings designed and protected for storage of NFPA Class I flammable liquids. Product should be stored in tightly sealed containers and protected from heat, moisture, and foreign materials. Store in a dry, well ventilated place. Keep container tightly closed when not in use. Keep away from heat, sparks, flame and sources of ignition. Avoid excess heat.

-						
Chemical Name	CAS-No.	Weight % Less Than	ACGIH TLV- TWA	ACGIH TLV- STEL	OSHA PEL-TWA	OSHA PEL- CEILING
Acetone	67-64-1	50.0	500 ppm	750 ppm	1000 ppm	N.E.
Liquefied Petroleum Gas	68476-86-8	30.0	N.E.	N.E.	N.É.	N.E.
Xylene (mixed isomers)	1330-20-7	10.0	100 ppm	150 ppm	100 ppm	N.E.
Solvent Naphtha, Light Aromatic	64742-95-6	5.0	N.E.	N.E.	N.E.	N.E.
1,2,4-Trimethylbenzene	95-63-6	5.0	25 ppm (NIOSH REL)	N.E.	N.E.	N.E.
Hydrous Magnesium Silicate	14807-96-6	5.0	2 mg/m3 (Respirable Dust)	N.E.	20 mppcf (Mineral Dust <1% Quartz)	N.E.
Ethylbenzene	100-41-4	5.0	20 ppm	125 ppm	100 ppm	N.E.
Aluminum Flake	7429-90-5	5.0	1 mg/m3	N.E.	15 mg/m3 [Total Dust]	N.E.
1,3,5-Trimethylbenzene	108-67-8	5.0	25 ppm	N.E.	N.E.	N.E.

8. Exposure Controls/Personal Protection

PERSONAL PROTECTION

ENGINEERING CONTROLS: Use explosion-proof ventilation equipment. Provide general dilution of local exhaust ventilation in volume and pattern to keep TLV of hazardous ingredients below acceptable limits. Prevent build-up of vapors by opening all doors and windows to achieve cross-ventilation. Use process enclosures, local exhaust ventilation, or other engineering controls to control airborne levels below recommended exposure limits.

RESPIRATORY PROTECTION: A respiratory protection program that meets OSHA 1910.134 and ANSI Z88.2 requirements must be followed whenever workplace conditions warrant a respirator's use. A NIOSH/MSHA approved air purifying respirator with organic vapor cartridge or canister may be permissible under certain circumstances where airborne concentrations are expected to exceed exposure limits.

SKIN PROTECTION: Use gloves to prevent prolonged skin contact. Nitrile or Neoprene gloves may afford adequate skin protection.

EYE PROTECTION: Use safety eyewear designed to protect against splash of liquids.

OTHER PROTECTIVE EQUIPMENT: Refer to safety supervisor or industrial hygienist for further guidance regarding types of personal protective equipment and their applications.

HYGIENIC PRACTICES: Wash thoroughly with soap and water before eating, drinking or smoking. Remove contaminated clothing immediately and launder before reuse.

9. Physical and Chemical Properties

Appearance:	Aerosolized Mist	Physical State:	Liquid
Odor:	Solvent Like	Odor Threshold:	N.E.
Relative Density:	0.750	pH:	N.A.
Freeze Point, °C:	N.D.	Viscosity:	N.D.
Solubility in Water:	Slight	Partition Coefficient, n-	No Information
Decompostion Temp., °C:	No Information	octanol/water:	No Information
Boiling Range, °C:	-34 - 999	Explosive Limits, vol%:	0.9 - 13.0
Flammability:	Does not Support Combustion	Flash Point, °C:	>93
Evaporation Rate:	Faster than Ether	Auto-ignition Temp., °C:	No Information
Vapor Density:	Heavier than Air	Vapor Pressure:	N.D.

(See "Other information" Section for abbreviation legend)

10. Stability and Reactivity

CONDITIONS TO AVOID: Flammable hydrogen gas will evolve when product comes in contact with water or damp air. Heat will be generated. The amount of heat generated will depend upon the volume of material in contact. Avoid temperatures above 120 ° F. Avoid contact with strong acid and strong bases. Avoid all possible sources of ignition.

INCOMPATIBILITY: Incompatible with strong oxidizing agents, strong acids and strong alkalies.

HAZARDOUS DECOMPOSITION: By open flame, carbon monoxide and carbon dioxide. When heated to decomposition, it emits acrid smoke and irritating fumes. Contains solvents which may form carbon monoxide, carbon dioxide, and formaldehyde.

HAZARDOUS POLYMERIZATION: Will not occur under normal conditions.

STABILITY: This product is stable under normal storage conditions.

11. Toxicological information

EFFECTS OF OVEREXPOSURE - EYE CONTACT: Causes Serious Eye Irritation

EFFECTS OF OVEREXPOSURE - SKIN CONTACT: May cause skin irritation. Allergic reactions are possible.

EFFECTS OF OVEREXPOSURE - INHALATION: High gas, vapor, mist or dust concentrations may be harmful if inhaled. High vapor concentrations are irritating to the eyes, nose, throat and lungs. Harmful if inhaled. Avoid breathing fumes, spray, vapors, or mist. Prolonged or excessive inhalation may cause respiratory tract irritation.

EFFECTS OF OVEREXPOSURE - INGESTION: Harmful if swallowed.

EFFECTS OF OVEREXPOSURE - CHRONIC HAZARDS: IARC lists Ethylbenzene as a possible human carcinogen (group 2B). Overexposure to xylene in laboratory animals has been associated with liver abnormalities, kidney, lung, spleen, eye and blood damage as well as reproductive disorders. Effects in humans, due to chronic overexposure, have included liver, cardiac abnormalities and nervous system damage. May cause central nervous system disorder (e.g., narcosis involving a loss of coordination, weakness, fatigue, mental confusion, and blurred vision) and/or damage. Reports have associated repeated and prolonged occupational overexposure to solvents with permanent brain and nervous system damage. High concentrations may lead to central nervous system effects (drowsiness, dizziness, nausea, headaches, paralysis, and blurred vision) and/or damage.

PRIMARY ROUTE(S) OF ENTRY: Eye Contact, Ingestion, Inhalation, Skin Absorption, Skin Contact

ACUTE TOXICITY VALUES

The acute effects of this product have not been tested. Data on individual components are tabulated below:

CAS-No.	<u>Chemical Name</u>	<u>Oral LD50</u>	Dermal LD50	Vapor LC50
1330-20-7	Xylene (mixed isomers)	4300 mg/kg Rat	N.I.	47635 mg/L Rat
64742-95-6	Solvent Naphtha, Light Aromatic	N.I.	>2000 mg/kg Rabbit	N.I.
95-63-6	1,2,4-Trimethylbenzene	3280 mg/kg Rat	>3160 mg/kg Rabbit	N.I.
100-41-4	Ethylbenzene	3500 mg/kg Rat	15354 mg/kg Rabbit	17.2 mg/L Rat

N.I. - No Information

12. Ecological Information

ECOLOGICAL INFORMATION: Product is a mixture of listed components.

13. Disposal Information

DISPOSAL INFORMATION: Dispose of material in accordance to local, state, and federal regulations and ordinances. Do not allow to enter waterways, wastewater, soil, storm drains or sewer systems.

14. Transport Information

	Domestic (USDOT)	International (IMDG)	<u>Air (IATA)</u>	<u>TDG (Canada)</u>
UN Number:	N.A.	1950	1950	N.A.
Proper Shipping Name:	Paint Products in Limited Quantities	Aerosols	Aerosols	Paint Products in Limited Quantities
Hazard Class:	N.A.	2.1	2.1	N.A.
Packing Group:	N.A.	N.A.	N.A.	N.A.
Limited Quantity:	Yes	Yes	Yes	Yes

15. Regulatory Information

U.S. Federal Regulations:

CERCLA - SARA Hazard Category

This product has been reviewed according to the EPA 'Hazard Categories' promulgated under Sections 311 and 312 of the Superfund Amendment and Reauthorization Act of 1986 (SARA Title III) and is considered, under applicable definitions, to meet the following categories:

Fire Hazard, Pressure Hazard, Acute Health Hazard, Chronic Health Hazard

Sara Section 313:

This product contains the following substances subject to the reporting requirements of Section 313 of Title III of the Superfund Amendment and Reauthorization Act of 1986 and 40 CFR part 372:

Chemical Name	<u>CAS-No.</u>
Xylene (mixed isomers)	1330-20-7
1,2,4-Trimethylbenzene	95-63-6
Ethylbenzene	100-41-4
Aluminum Flake	7429-90-5

Toxic Substances Control Act:

This product contains the following chemical substances subject to the reporting requirements of TSCA 12(B) if exported from the United States:

No TSCA components exist in this product.

CALIFORNIA PROPOSITION 65:

WARNING: This product contains a substance known to the State of California to cause cancer.

Chemical Name	<u>CAS-No.</u>
Ethylbenzene	100-41-4

CALIFORNIA PROPOSITION 65 REPRODUCTIVE TOXINS

WARNING: This product contains a substance known to the State of California to cause birth defects or other reproductive harm.

CAS-No. 108-88-3

<u>Chemical</u>	<u>Name</u>
Toluene	

International Regulations:

CANADIAN WHMIS:

This SDS has been prepared in compliance with Controlled Product Regulations except for the use of the 16 headings.

Page 7 / 7


16. Oth	ner Inf	ormation					
HMIS RA Health:	TINGS 2*	Flammability:	4	Physical Hazard:	0	Personal Protection:	х
CANADIA NFPA RA		MIS CLASS:	AB5 D2A				
Health:	2	Flammability:	4	Instability	0		
VOLATILE	E ORGA		NDS, g/L:	578			
MSDS RE	VISION	DATE:	3/24/2015				
REASON	FOR RE	EVISION:	No Information				

Legend: N.A. - Not Applicable, N.E. - Not Established, N.D. - Not Determined

Text for GHS Hazard Statements shown in Section 3 describing each ingredient:

H225	Highly flammable liquid and vapour.
H226	Flammable liquid and vapour.
H228	Flammable solid.
H261	In contact with water releases flammable gases.
H312	Harmful in contact with skin.
H315	Causes skin irritation.
H319	Causes serious eye irritation.
H332	Harmful if inhaled.
H335	May cause respiratory irritation.
H336	May cause drowsiness or dizziness.
H340	May cause genetic defects <state cause="" conclusively="" exposure="" hazard="" if="" is="" it="" no="" of="" other="" proven="" route="" routes="" that="" the="">.</state>
H350	May cause cancer <state cause="" conclusively="" exposure="" hazard="" if="" is="" it="" no="" of="" other="" proven="" route="" routes="" that="" the="">.</state>

Icons for GHS Pictograms shown in Section 3 describing each ingredient:

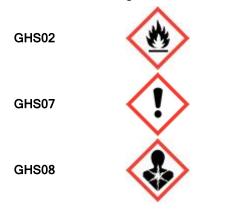

Rust-Oleum Corporation believes, to the best of its knowledge, information and belief, the information contained herein to be accurate and reliable as of the date of this safety data sheet. However, because the conditions of handling, use, and storage of these materials are beyond our control, we assume no responsibility or liability for personal injury or property damage incurred by the use of these materials. Rust-Oleum Corporation makes no warranty, expressed or implied, regarding the accuracy or reliability of the data or results obtained from their use. All materials may present unknown hazards and should be used with caution. The information and recommendations in this material safety data sheet are offered for the users' consideration and examination. It is the responsibility of the user to determine the final suitability of this information and to comply with all applicable international, federal, state, and local laws and regulations.